

# SQUEAK/CREAK NOISE FROM STEERING RACK WHEN TURNING

TSB 05-14-3

## FORD:

2002-2004 Mustang

This article supersedes TSB **04-24-8** to update the Action.

## ISSUE

Some 2002-2004 Mustang vehicles may exhibit a squeak or creak type noise when turning.

## ACTION

Replace both power steering gear tube brackets. Refer to Workshop Manual Section 211-02 Steering Gear Mounting. Tighten the steering gear mounting fasteners to 52 lb-ft (70 N•m).

**WARRANTY STATUS:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION	DESCRIPTION	TIME
051403A	2002-2004 Mustang Replace Power Steering Gear Tube Bracket (Do not use with 3504A)	0.8 Hr.

## DEALER CODING

BASIC PART NO.  
3K620

CONDITION  
CODE  
16

PART NUMBER	PART NAME
E5DZ-3K620-A	Bracket

**NOTE:** The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.